


Type Herst.	PP 4100 Tu
U_f	4
I_f	0,6
Heizart	B~
Verw.	EP
Kbn-Lg.	—
Kbn-Ø	—
U_a	400
U_{g5}	—
U_{g4}	—
U_{g3}	—
U_{g2}	200
U_{g1}	-23
I_a	30
I_{g2}	7
S	2,3
D	21 ⁶⁾
R_i	25
R_k	0,6
R_a	12
R_{g2}	—
$U_{g1} \sim$	16
V	—
$N_a \sim$	5,8
U_b max	400
U_{g2} max	200
N_a max	12
N_{g2} max	2
R_{g1} max	0,6
$C_{g/a}$	1,9

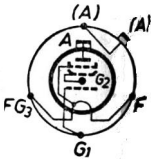

PP 4100