


Type Herst.	RS 629 Te	
U_1	6,3	12,6
I_1	34	17
Heizart	~	
Verw. Kbn-Lg.	ST ³²⁾	
Kbn-Ø	260 (20)	
	92	
U_a	3000	
$U_{\theta 5}$	4 ³⁰⁾ 11 ³¹⁾	
$U_{\theta 4}$	—	
$U_{\theta 3}$	—	
$U_{\theta 2}$	—	
$U_{\theta 1}$	—	
I_a	—	
$I_{\theta 2}$	—	
S	4	
D	3	
R_i	—	
R_k	—	
R_a	—	
$R_{\theta 2}$	—	
$U_{\theta 1} \sim$	—	
V	—	
$N_a \sim$	1000	
U_b max	5000	
$U_{\theta 2}$ max	—	
N_a max	500	
$N_{\theta 2}$ max	125	
$R_{\theta 1}$ max	—	
$C_{\theta/a}$	7	

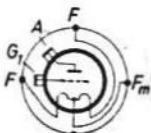

RS 629