


Type Herst.	T114 Te Ra, AEG
$U_f$ $I_f$ Heizart	2 0,9 B
Verw. Elektrometer Kbn-Lg. Kbn-Ø	— —
$U_a$ $U_{g5}$ $U_{g4}$ $U_{g3}$ $U_{g2}$ $U_{g1}$	6 4 <sup>24</sup> ) — — — -4
$I_a$ $I_{g2}$	0,12 0,3 <sup>25</sup> )
S D $R_i$	0,055 100 —
$R_k$ $R_a$ $R_{g2}$	— — —
$U_{g1} \sim$ V $N_a \sim$	— — —
$U_b$ max $U_{g2}$ max $N_a$ max $N_{g2}$ max $R_{g1}$ max	6 6 <sup>24</sup> ) — — —
$C_{g/a}$	1,5

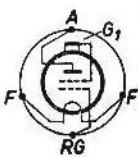

T 114