


Type Herst.	1	VRS 351 ¹ WF
U_f		12,6
I_f		0,95
Heizart		~
Verw. Kbn-Lg.		ST ⁷⁵)
Kbn- \varnothing		85 (12,5)
		45
U_a		50...60
$U_{\theta 5}$		—
$U_{\theta 4}$		—
$U_{\theta 3}$		—
$U_{\theta 2}$		—
$U_{\theta 1}$		-4...-9
I_a		200
$I_{\theta 2}$		—
S		21
D		$T_a=180^{\circ}$
R_i		0,12
R_k	3	$c/e=11,5$
R_a		$U_f/k=$
$R_{\theta 2}$		150 V
$U_{\theta 1} \sim$		$c/a=3,5$
V		$g=2,5$
$N_a \sim$		$Ik=250$
U_b max		150
$U_{\theta 2}$ max		100
N_a max		25
$N_{\theta 2}$ max		0,5
$R_{\theta 1}$ max		0,05
c_g/a		11,5

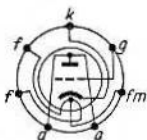

VRS 351