


WG 37 OL			Type Herst.
75			U_f
0,18			I_f
\cong			Heizart
H	A	EP	Verw. Kbn-Lg. Kbn-Ø
—	—	—	
200	200 ¹⁾	200	U_a
—	—	—	U_{g5}
—	—	—	U_{g4}
100	—	-8	U_{g3}
100	40	200	U_{g2}
-1,5	-1,5	-8	U_{g1}
4	0,35	35	I_a
1,7	0,08	10	I_{g2}
2,7	1	4,5	S
5 ⁶⁾	3,5 ⁶⁾	10 ⁶⁾	D
750	2000	45	R_i
—	—	—	R_k
—	350	9	R_a
—	2500	—	R_{g2}
—	—	—	$U_{g1} \sim$
—	—	—	V
—	—	3,5	$N_a \sim$
300	300	300	U_b max
200	100	250	U_{g2} max
1,5	0,5	8	N_a max
1	0,5	2,5	N_{g2} max
—	—	—	R_{g1} max
—	0,1	—	$c_{g/a}$

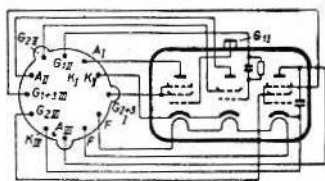

WG 37